
CITY OF BALTIMORE WET W SMOKE AND DYED W	Page <u>1</u> of <u>6</u>	
Sewershed: JONES FALLS SEWERSHED	Company: Savin Engineers	Date: 7/25/08
Test to be Performed:	Ground Condition:	Supervisor: GS
Smoke: _X Dyed Water:	Dry: X Damp: Wet:	
Manhole ID: S25GG 010	Test ID: 0994-674	Notifications Made: x (Residents, Fire, 311)



CITY OF BALTIMORE WET WEATHER CONSENT DECREE SMOKE AND DYED WATER TESTING FORM					Page <u>2</u> of <u>6</u>					
Sewershed: Jones Falls			Company: Savin Engineers				Date: 7/25/08			
Test to	be Performed:			Ground	Condition			Supervisor: GS		
Smoke	e: X Dye	d Water:		Dry: X	Dry: _X Damp: Wet:				·	
Manhole ID: S25GG 010		Test ID: 0994-674			Notifications Made:X(Residents, Fire, 311)					
Field Sketch: (Show all Manholes with Numbers, E Locations, Street Names, Building Addresses and Lo							_			
Defect				Source			Drainage	<u> </u>	Photo	
No.		Address		Type	Location	Sector	Area	Severity	Number	
1	MH 25GG 044			10	02	01	50	02	OB01-01	
	1911 Etting Stre			03	80	02	01	03	OB02-01	
	1908 Druid Hill	Ave.		03	80	02	100	03	OB03-01	
	MH 25GG 027			10	02	01	50	03	OB04-01	
	MH 25GG 014			10	02	01	50	03	OB05-01	
	MH 25GG 065			10	01	01	100	03	OB06-01	
	7 Alley behind 1903 Division Street			16	01	01	200	04	OB07-01	
8	1910 Etting Stre	eet		02	80	02	100	04	OB08-01	
				ODOEDI	ATION	00050				
	OBSERVATION CODES									
0.1	Source Type	Location	Sector	Severity	40	Source Type	Location			
	Main Sewer	Paved Concrete	Public	No Smoke		MH Frame Seal	Non-Paved			
	Service Line	Paved Asphalt	Private	Trace		Storm Drain	Field/Woods			
	Cleanout	Paved Other		Moderate		Catch Basin/Inlet				
	Downspout Area Drain	Driveway		Major		Storm Manhole	Golf Course		 	
	Area Drain	Sidewalk				Storm Ditch Excavation	Other		-	
	Driveway Drain Stairwell Drain	Curb Yard- Front				Other			-	
	Foundation Drain	Yard- Front Yard-Back			16	Ottlet				
	Building Interior	Yard-Side								

CITY OF BALTIMORE WET W SMOKE AND DYED W	Page <u>3</u> of <u>6</u>	
Sewershed: JONES FALLS SEWERSHED	Company: Savin Engineers	Date: 7/25/08
Test to be Performed:	Ground Condition:	Supervisor: GS
Smoke: _X Dyed Water:	Dry: X Damp: Wet:	
Manhole ID: S25GG 010	Test ID: 0994-674	Notifications Made: x (Residents, Fire, 311)

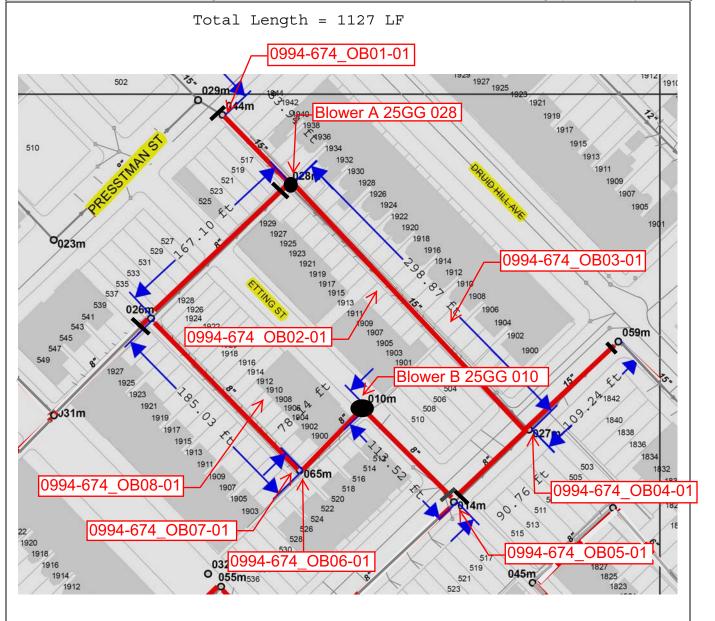

0994-674_OB01-01



CITY OF BALTIMORE WET W SMOKE AND DYED W	Page <u>4</u> of <u>6</u>	
Sewershed: JONES FALLS SEWERSHED	Company: Savin Engineers	Date: 7/25/08
Test to be Performed:	Ground Condition:	Supervisor: GS
Smoke: _X Dyed Water:	Dry: X Damp: Wet:	
Manhole ID: S25GG 010	Test ID: 0994-674	Notifications Made: x (Residents, Fire, 311)



0994-674_OB03-01



0994-674_OB04-01

CITY OF BALTIMORE WET W SMOKE AND DYED W	Page <u>5</u> of <u>6</u>	
Sewershed: JONES FALLS SEWERSHED	Company: Savin Engineers	Date: 7/25/08
Test to be Performed:	Ground Condition:	Supervisor: GS
Smoke: _X Dyed Water:	Dry: _X Damp: Wet:	
Manhole ID: S25GG 010	Test ID: 0994-674	Notifications Made: x (Residents, Fire, 311)



0994-764_OB05-01



0994-674_OB06-01

CITY OF BALTIMORE WET W SMOKE AND DYED W	Page <u>6</u> of <u>6</u>	
Sewershed: JONES FALLS SEWERSHED	Company: Savin Engineers	Date: 7/25/08
Test to be Performed:	Ground Condition:	Supervisor: GS
Smoke: _X Dyed Water:	Dry: X Damp: Wet:	
Manhole ID: S25GG 010	Test ID: 0994-674	Notifications Made: x (Residents, Fire, 311)



0994-674_OB07-01



0994-674_OB08-01